Coffeemaker "Espresso Duo"

HD5660/A

Service
Service
Service

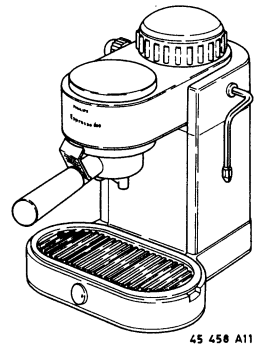

Domestic Appliances and Personal Care Division

ServiceManual

Product information

Voltage	: 220-230V, 230-240V
Frequency	: 50-60 Hz
Power consumption	: 840W, 760W
Coloursetting	: white version black version red version

Service information

Thermostat switch-off temp. : 140° + 5° C
Thermal fuse cut-off temp. : 216° – 4° C

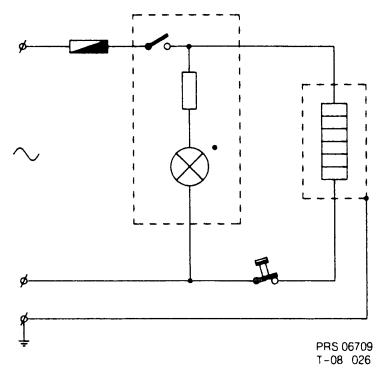

Repair instructions

1. Removing fuse
   The thermal fuse (item 10) can be removed by levering carefully the small spring bracket from the stud. Do not damage this stud in order to maintain the original diameter for keeping in place the new fixing bracket.

2. Replacing control rings (item 7)
   Before placing the control rings, the two ceramic rings have to be greased. We advise to use Molykote Q5-7508.

3. De-scaling
   In case the valve system and steam pipe device is nearly or less clogged by scale, then operate the appliance a few times with vinegar or a 10-15% solution of either vinegar-acid, citric-acid or tartar-acid, in cold tap water.
   Do not use other de-scaling agents as they may harm the appliance.
   After the de-scaling procedure, operate the coffeemaker 2 times with tap water to rinse away any residual substances.

91/02 Published by Philips Consumer Service Printed in The Netherlands ©Copyright reserved Subject to modification 4822 729 21119

PHILIPS

PHILIPS

HD5660/A

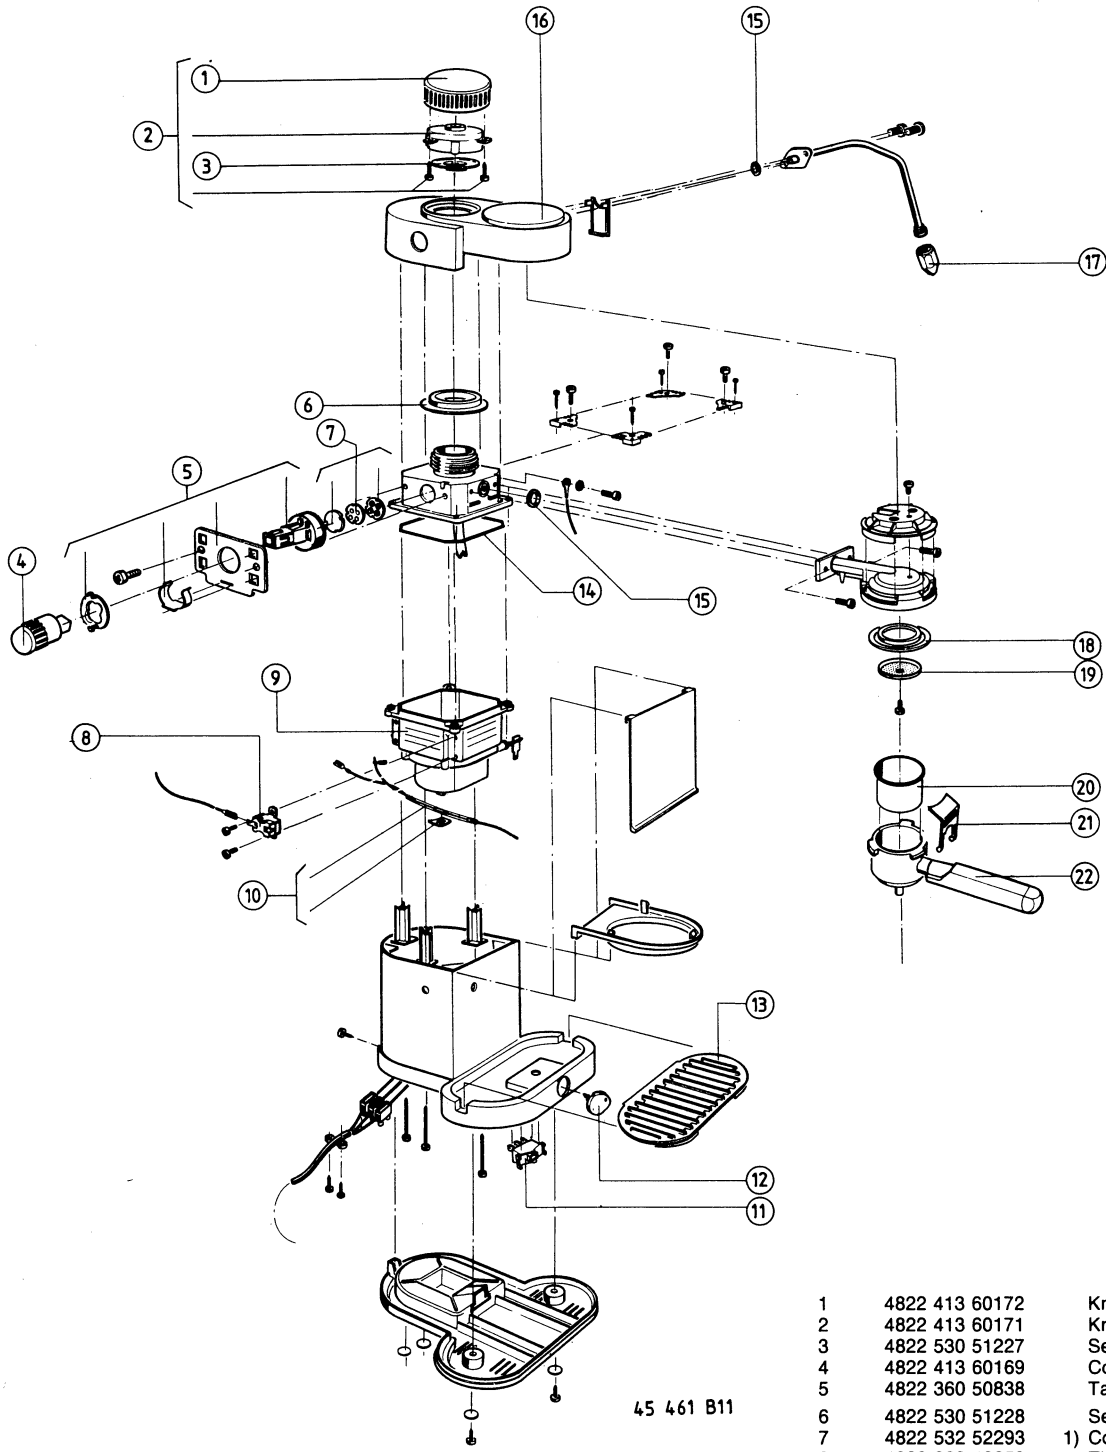

1	4822 413 60172	Knob	(black)
2	4822 413 60171	Knob unit	(black)
3	4822 530 51227	Sealing ring	
4	4822 413 60169	Control knob	
5	4822 360 50838	Tap unit	
6	4822 530 51228	Sealing ring	
7	4822 532 52293	1) Control rings	
8	4822 282 40259	Thermostat	140°C
9	4822 259 20393	Element unit	220V
10	4822 252 20268	Fuse	216°C
11	4822 276 13026	Switch	
12	4822 411 50597	Switch knob	(black)
13	4822 441 31076	Drip tray	(black)
14	4822 466 62007	Packing ring	
15	4822 530 51229	Set of O-rings	
16	4822 441 31074	2) Cover	(black)
17	4822 360 60269	Nozzle	
18	4822 530 51226	Sealing ring	
19	4822 480 50445	Sprinkler	
20	4822 480 50446	Filter	
21	4822 441 31075	Bracket	
22	4822 256 91737	3) Filterholder	

1) See repair instructions
2) Only the black cover has been listed
3) Filterholder, bracket item 21 included